Today's Date	Date 5/1/2023		Bus Name _		/	Avalanche			
Yr/Make/Model	ake/Model 2005 Prevost XLII		VIN#_		2PCY	334954102	8309		
Mileage	149,694	/ ECM :	367,091	Door Code _	1131	1 (inop)	Tec	h & Time:	mb - 2.5
Engine Type	Detroit	Series 60		Transmission Type _	Allison B	500	Genera	tor Gen H	lours
Engine Serial #	06R0	74934		nsmission Serial#	6618128	892		14,4	420
			DO	T Compliance Items					
	OK	Repair	Technician's Note	es:		Qty:	Per Piece:	Price:	Labor:
Driving Fog Lights						-			
Gauge Lights		X	needs 5			5	\$7.28	\$36.40	1.5
Dash Lights		X	see above						
ABS Light		X	on						TBD
Headlights Brake Lights					and the second s	ļ	1		
Clearance Lights		X	1 upper red			1 -	\$128.88	\$128.88	0.25
Tail Lights		X		r - 2 lower amber		5	\$49.30	\$246.50	2.25
			1 led red	MERCHANIS .		1	\$102.49	\$102.49	0.5
Turn Lights		X	d/s front			11	\$203.06	\$203.06	0.5
Escape Hatch Operational		X	none						TBD
Windshield		X	p/s cracked			1	\$1,125.87	\$1,125.87	2.25
Driver Glass	* X								
Windshield Wipers	* X		·						
Upper Control Arms	*	Х	need replaced			2	\$1,364.30	\$2,728.60	8
Lower Control Arms	*	Х	d/s bent			2	\$1,351.47	\$2,702.94	8
Suspension - Front	* X								
Suspension - Rear	* X			and the same of th					
Power Steering	* X					†			
Exhaust System/Muffler	* X								
				Brakes		Na de la companya de			
Front %	* 80%		-						
Drive %									
Tag%									
Jake Brake									
Shock - Front									
Shock - Rear		X	need drive & t			6	\$156.53	\$939.18	3
				Tires			_		H H H H H H
Front %			15/32 15/32	- DOT2022					
Drive %			11/32 11/32	11/32 11/32 - DOT	2022				
Tag %		X	12/32 - DOT	2018 -D/S needs rep	laced	1	\$1,514.34	\$1,514.34	1.5
Wheelseals - Front				·		-			
Wheelseals - Rear	* X								
				Seat Belts					
Driver						-	-		
Jump									
Passenger (if applicable)	* N/A	N/A							
				Other					Kell-Walle
Alignment		X	done w/ contr	ol arms		1	\$1,060.00	\$1,060.00	
Sway Bar Links			need replaced	l		2	\$239.66	\$479.32	1.5
Tie Rods			need replaced	l		2	\$427.57	\$855.14	1.5
Main Engine	<u>. </u>		surges on low	idle					TBD
				1				* DOT Require	ement

			Conversion / Bus Interior		Bus Nan	ne: Avaia	ncne
	ОК	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	_abor:
Smoke/Co2 Detector		Х	none	1	\$110.25	\$110.25	0.25
Switch Lights	Х						
Switch Identification	X						
Water Pump Operation	X						
Fresh Water Drain		Х	needs replaced - broken				TBD
Sewer Drain	Х						
Air Vents Dash	X				<u> </u>		
Air Vents Coach	X						
Driver Stereo	X						
BackUp Camera		X		<u> </u>			
	X		no picture	ļ			TBD
Driver Seat Operation							
Driver Seat	X						
			Finishes				
Tile Condition	X						
Laminate Condition	X						
Shower Operational	N/A	N/A		<u> </u>			
Air Pocket Doors	X		rear lounge door needs adjusted	+			TBD
Pocket Doors	N/A	N/A	real lounge door needs adjusted	1			100
Cabinet Hardware		Х	2 need adjustment in rear lounge	2		-	1
Ceiling Mirrors	N/A	N/A	2 fleed adjustifient in real lounge			-	
Shower Head	N/A	N/A		+	 	 	
Sink Head	X			 			
Upholstery-Front	X			 		-	
Upholstery-Rear	X			-	-		
Window Tint	X			-		-	
Windshield Rubber	X			<u> </u>			
vvinasniela Rubber			Final Creaters				
			Fuel System	A STATE OF THE STATE OF		V 3 4 5 5 7 19 9	Action to the Control of the Control
Fuel Level	X		1/2 tank				
Level Low System	Х		1/2 talk				
			Bumpers				
Front Bumper	Х						
Rear Bumper	Х						
			Keys				
Door Code/Keypad		Х	inoperable				TBD
Door	X		inoperable	+	+		IBD
Ignition	X	$\vdash \vdash \vdash$		+			
Engine	X	\vdash	-	-	 	-	
	X			+	-		
Bays		NI/A			_		
Cabinets/Interior	N/A	N/A					
			Other				
Bay Floor		Х	harless out at new t t				TDD
	=		broken out at genset exhaust		+	-	TBD
Oil Pan Gasket	=	X	leaking		\$133.92	\$133.92	2.5
Oil Cooler		X	leaking		\$446.43	\$446.43	6
Balance Light		х	on - on dash (vanner)				TBD
			on an addit (varinor)	 			, 50
				+	+		
	L			1			

			Electronics / Remotes		Bus Nan	ne: Avala	HOHE
	ок	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
Stereo Operational-F	Х						
Stereo Operational-R	X						
TV - Front	X						
TV - Rear	Х						
Generator Remote Start	Х				**************************************		
Genset Batteries	X						
Inverter Remote	Х						
In-Motion Satellite Locks			unknown				
Speakers Operational	Х						
Satellite Syst. Operational			unknown				
Rooftop A/C		Х	2 need new interior cover panels	2	\$127.15	\$254.30	1
			Switches / Gauges / Lights				
Ship to Shore Switch/Plug	Х				T		
Interior Lights 12v		Х	needs 4 ceiling bulbs	4	\$6.18	\$24.72	0.25
Interior Lights 120v	X		needs , coming banks		ψ0.10	Ψ27.72	0.25
Light Switches	Х						
Step Lights		Х	inoperable	all			TBD
Buddy Light	X						
Driver Light		Х	inoperable	1	\$30.51	\$30.51	0.5
Day/Night Shades		Х	d/s rear lounge need re-strung	1		4.00.0	TBD
Toilet	X						
Speedometer	X						
Fuel Gauge	Х						
Temp Gauge	X						
Amp Gauge	Х						
Volt Gauge	X						
DC Volt Gauge		Х	inoperable	1	\$389.81	\$389.81	3
			Operations				
Roof Vent Fans	N/A	N/A					
Roof/CruiseAir Operational	X						
Roof/Cruise Air Filters		Х	need cleaned	5	1		0.5
Hot Water Heater		Х	need replaced (burst)	1	\$738.15	\$738.15	TBD
Step Slide Operational	N/A	N/A		<u> </u>		\$1.00.10	
Webasto	N/A	N/A					
Toe Kick Heaters		Х	front lounge inoperable	1			TBD
Heat Pumps	X						
Fan Clutch		Х	locked in	1	\$2,109.74	\$2,109.74	2.5
City/Air Horn	X					, , , , , ,	
A/C Air Tank	X						
Alignment		Х	see page 1				
			Bunks				
Dunk Lights							
Bunk Lights		X	1 inoperable	1	\$12.97	\$12.97	0.25
Condo Curtains		X	none				TBD
Bunk Curtains	X						
Mattresses	X						
Bunk TV's			did not test				

					Bus Nam	ne: Avala	nche
	OK	Repair	Engine & Mechanical Technician's Notes:	Ohr	Per Piece:	Price:	Labor:
ECM Codes		X	pid 351 inactive - electrical fault	Qty:	Per Piece:	Price:	TBD
House Alternator Charge	X		pla do i madrive - cicomdar laur				100
Drive AC Operational			unknown				
Coach AC Operational			unknown				
Coach AC Components			unknown				
HVAC Motor Brushes			unknown - alt & 1 inop - will not power up		 		TBD
House Batteries	Х		and own are a mop will not power up				100
Chassis Batteries	Х						
Radiator Condition	Х						
Belt Condition		Х	needs all belts	6	\$50.41	\$302.45	0.5
Charge Air Cooler	Х		neede dir beite		φου.+1	Ψ002.40	0.0
Airbags	Х						
Transmission Seal	Х						
Rear Main Seal		X		1	\$1,928.50	\$1,928.50	10.75
Pinion Seal	Х						
Mitre Box Seals	Х						
50DN Seals	N/A	N/A					
Charging		Х	alt light on - need #1 alt	1	\$1,321.04	\$1,321.04	2
Mitre Box Dipstick	X						
Oil Dipstick	Х						
Trans Dipstick	X						
Differential Oil	Х						
Coolant Level	X						
Transmission Fluid Level	X						
Motor Oil Level	X				1		
Power Steering Level					-		
			Exterior				
Body Damage							
Bay Door Shocks	X		see page 6				
Bay Door Actuators		X	wands 5	 -	04000:	650175	
Bay Door Operation	X		needs 5	5	\$106.94	\$534.70	1.75
Roof Inspection	X						
Roof Seals	X						
Mirror Chrome Condition		X	floking	+-	¢4 960 04	to 700 04	TDD
Door Latches	X		flaking	2	\$1,860.01	\$3,720.01	TBD
Trailer Wiring	X	\vdash			+		
Rub Rails	X				+		***
Side Glass	X				+		
Entrance Door Glass	X						
Shore Cord	X				-		
Awning Operable	N/A	N/A	-		-		
Docking Lights	I III	X			-		
			d/s front	1	\$189.30	\$189.30	0.25
Mirror Operation		X	all inoperable		-		TBD
Paint Repair			see page 6		-		
Vanner		X	needs replaced	1	\$1,203.00	\$1,203.00	0.75

INSPECTOR'S NAME (PRINT OR TYPE)

Avalanche

ANNUAL VEHICLE INSPECTION REPORT

REPORT NUMBER	FLEET UNIT NUMBER
DATE	

ADDRESS			THIS INSPECTOR MEETS THE	THIS INSPECTOR MEETS THE QUALIFICATION REQUIREMENTS IN SECTION 396.19.			
CITY, STATE, ZIP CO	ODE		VEHICLE IDENTIFICATION (VEHICLE IDENTIFICATION (► AND COMPLETE) ☐ LIC. PLATE NO. ☐ VIN ☐ OTHER			
	TRACTOR ☐ TRAILER ☐ TRUCK (OTHER)	□ BUS	INSPECTION AGENCY/LOCATION	INSPECTION AGENCY/LOCATION (OPTIONAL)			
		VEHICLE	OMPONENTS INSPECTED				
OK NEEDS REPAIRED DATE	ITEM	OK NIEDS REPAIRED DATE	ITEM	OK NEEDS REPARED DATE	ITEM		
The second of	1. BRAKE SYSTEM		6. SAFE LOADING		10, TIRES		
1	a. Service Brakes		a. Part(s) of vehicle or		a. Tires on any steering axle		
7	b. Parking Brake System		condition of loading such	メー	of a power unit.		
1	c. Brake Drums or Rotors	V	that the spare tire or any	×	b. All other tires.		
2	d. Brake Hose		part of the load or dunnage		11. WHEELS AND RIMS		
×	e. Brake Tubing		can fall onto the roadway.	NIA	a. Lock or Side Ring		
	f. Low Pressure Warning		b. Protection against shifting	×	b. Wheels and Rims		
x	Device	2/2	cargo.	X	c. Fasteners		
7	g. Tractor Protection Valve		c. Container securement	al Ca	d. Welds		
X	h. Air Compressor	MIA	devices on intermodal		12. WINDSHIELD GLAZING		
11/4	i. Electric Brakes				Requirements and exceptions		
			equipment. 7. STEERING MECHANISM		as stated pertaining to any		
2/4	j. Hydraulic Brakes	21		x			
HIL	k. Vacuum Systems	2	a. Steering Wheel Free Play		crack, discoloration or vision		
	2. COUPLING DEVICES	X	b. Steering Column	160	reducing matter (reference		
11/2	a. Fifth Wheels		c. Front Axle Beam and All		393.60 for exceptions).		
25/10	b. Pintle Hooks	X	Steering Components		13. WINDSHIELD WIPERS		
X	 c. Drawbar/Towbar Eye 		Other Than Steering		Any power unit that has an		
×	 d. Drawbar/Towbar Tongue 		Column	X	inoperative wiper, or missing		
¥	e. Safety Devices	X	d. Steering Gear Box		or damaged parts that render		
N/A	f. Saddle-Mounts	7	e. Pitman Arm		it ineffective.		
- 2	3. EXHAUST SYSTEM	X	f. Power Steering		14. OTHER		
	 a. Exhaust system leaking 	×	 g. Ball and Socket Joints 	9.0	List any other condition(s)		
	forward of or directly below	X	h. Tie Rods and Drag Links		which may prevent safe		
X	the driver/sleeper	×	i. Nuts		operation of this vehicle.		
	compartment.	X	j. Steering System	1.	liants		
	b. Bus exhaust system		8. SUSPENSION	1-			
2	leaking or discharging in		a. Any U-bolt(s), spring		windshield		
	violation of standard.		hanger(s), or other axle		Shocks		

✓ OK, X NEEDS REPAIR, NA IF ITEMS DO NOT APPLY. CERTIFICATION: THIS VEHICLE HAS PASSED ALL THE INSPECTION ITEMS FOR THE ANNUAL VEHICLE INSPECTION IN ACCORDANCE WITH 49 CFR PART 396.

positioning part(s) cracked, broken, loose or missing

axle from its normal position.

resulting in shifting of an

c. Torque, Radius or Tracking

b. Tire and Wheel Clearance

Assemblies (Sliding

b. Spring Assembly

Components

a. Frame Members

c. Adjustable Axle

Subframes)

© Copyright 2010 J. J. KELLER & ASSOCIATES, INC.© Neenah, WI • USA • (800) 327-6868 jjkeller.com • Printed in the United States

c. Exhaust system likely to

the motor vehicle.

LIGHTING DEVICES

shall be operable.

All lighting devices and

4. FUEL SYSTEM

a. Visible leak.

burn, char, or damage the

or any combustible part of

b. Fuel tank filler cap missing. c. Fuel tank securely attached.

reflectors required by Part 393

INSTRUCTIONS: MARK COLUMN ENTRIES TO VERIFY INSPECTION:

NIA

electrical wiring, fuel supply,

MOTOR CARRIER OPERATOR

ORIGINAL

400-FS-C2 3127 Rev. 6/10

REPAIRED DATE

lower control aens


Stabilized links

tie Reds

tactice

Bus Name:

Avalanche

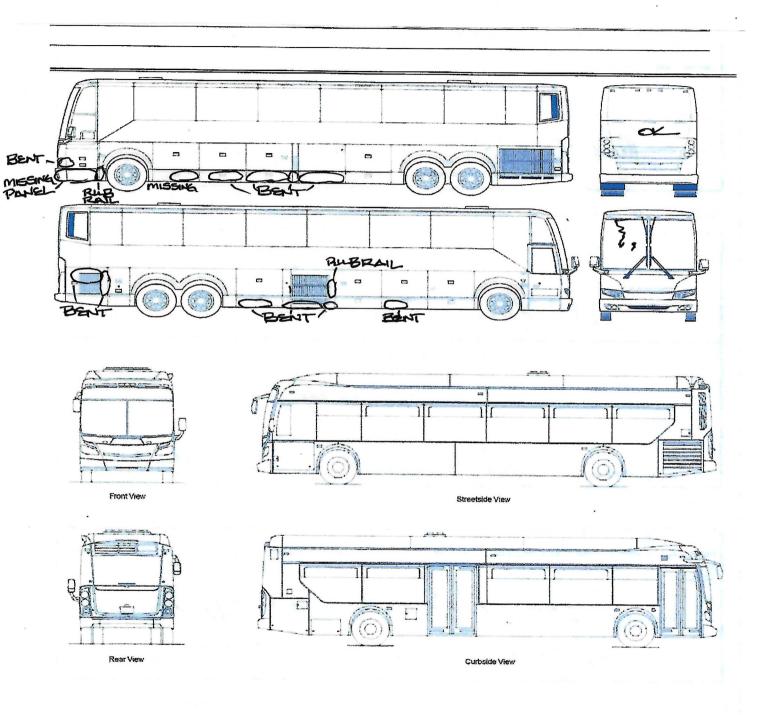



BusForSale.com

Estimate

#60 05/02/2023

Bill To

TOTAL

\$18,831.73

Expires: 06/01/2023

Expires	Exp. Close	Project	Sales Rep	
06/01/2023	05/02/2023	Avalanche Avalanche		
Quantity	Item		Rate	Amount
1	Sub-Repair(s) DOT ESTIMATE			\$0.00
5	Sub-Repair(s) gauge/dash lights		\$7.28	\$36.40
1.5	Sub-Repair(s) labor		\$150.00	\$225.00
1	Sub-Repair(s) brake lights		\$128.88	\$128.88
0.25	Sub-Repair(s) labor		\$150.00	\$37.50
5	Sub-Repair(s) clearance lights		\$49.30	\$246.50
2.25	Sub-Repair(s) labor		\$150.00	\$337.50
1	Sub-Repair(s) tail lights		\$102.49	\$102.49
0.5	Sub-Repair(s) labor		\$150.00	\$75.00
1	Sub-Repair(s) turn lights		\$203.06	\$203.06
0.5	Sub-Repair(s) labor		\$150.00	\$75.00
1	Sub-Repair(s) windshield		\$1,125.87	\$1,125.87
2.25	Sub-Repair(s) labor		\$150.00	\$337.50
2	Sub-Repair(s) upper control arms		\$1,364.30	\$2,728.60
8	Sub-Repair(s) labor		\$150.00	\$1,200.00
2	Sub-Repair(s) lower control arms		\$1,351.47	\$2,702.94
				1 of 3



ENC®RE

Estimate

BusForSale.com

#**60** 05/02/2023

uantity	Item	Rate	Amoun
8	Sub-Repair(s) labor	\$150.00	\$1,200.00
1	Sub-Repair(s) alignment (done w/control arms)	\$1,060.00	\$1,060.00
6	Sub-Repair(s) shock - drive & tag axle	\$156.53	\$939.1
3	Sub-Repair(s) labor	\$150.00	\$450.0
1	Sub-Repair(s) tire - tag	\$1,514.34	\$1,514.3
1.5	Sub-Repair(s) labor	\$150.00	\$225.0
2	Sub-Repair(s) sway bar links	\$239.66	\$479.3
1.5	Sub-Repair(s) labor	\$150.00	\$225.0
2	Sub-Repair(s) tie rods	\$427.57	\$855.1
1.5	Sub-Repair(s) labor	\$150.00	\$225.0
	SubTotal SubTotal		\$16,735.2
1	Sub-Repair(s) shop/epa fee		\$502.0
1	Sub-Repair(s) TO BE DETERMINED ITEMS: abs light on escape hatch main engine surge on low idle		\$0.0
		Subtotal	\$17,237.2
		Tax Total (%)	\$1,594.4
		Total	\$18,831.7



Estimate

BusForSale.com

05/02/2023

Key Considerations

This quote is an estimate based on routing provided. A final invoice may be issued for any additional expenses.

Any additional expenses will be billed to the credit card on file (from the contract) for any additional expenses not included in the quote, but remain unpaid after 30 days from the invoice date. In addition, any tolls that are received by Encore after tour completion will be charged to the credit on file. (Most times the municipalities are tardy in sending out toll charges.)

- Buses are not held until a signed contract and deposit are received.

Costs to Be Paid by Customer by Client Credit Card or "Float" while on Tour

-Parking -Tolls

-Permits

-Bus supplies and/or stock -Daily hotels on tour -Taxes

In accordance with the Federal DOT regulations the driver of the vehicle may not exceed 10 hours of driving time or 15 hours of on-duty time without taking an 8 hour off-duty break. The driver may not exceed 60 hours of on-duty time in a 7 day period or 70 hours of on-duty time in an 8 day period. With the new ELD laws in effect, there is an increased demand for double-drivers. If a double driver is needed, we must be notified within 14 days prior to the trip or we cannot be held responsible, or we may not be able to accommodate the request.





BusForSale.com

Estimate

#**61** 05/02/2023

Bill To

TOTAL

\$20,831.37

Expires: 06/01/2023

Expires	Exp. Close	Project	Sales Rep	
06/01/2023	05/02/2023	Avalanche Avalanche		
Quantity	Item		Rate	Amount
1	Sub-Repair(s) smoke/c02 detector		\$110.25	\$110.25
0.25	Sub-Repair(s) labor		\$150.00	\$37.50
1	Sub-Repair(s) adjust cabinet hardware in lounge		\$150.00	\$150.00
1	Sub-Repair(s) oil pan gasket leak		\$133.92	\$133.92
2.5	Sub-Repair(s) labor		\$150.00	\$375.00
1	Sub-Repair(s) oil cooler leak		\$446.43	\$446.43
6	Sub-Repair(s) labor		\$150.00	\$900.00
2	Sub-Repair(s) rooftop a/c interior cover panels		\$127.115	\$254.23
1	Sub-Repair(s) labor		\$150.00	\$150.00
4	Sub-Repair(s) interior lights 12v		\$6.18	\$24.72
0.25	Sub-Repair(s) labor		\$150.00	\$37.50
1	Sub-Repair(s) driver light		\$30.51	\$30.51
0.5	Sub-Repair(s) labor		\$150.00	\$75.00
1	Sub-Repair(s) dc volt gauge		\$389.81	\$389.81
3	Sub-Repair(s) labor		\$150.00	\$450.00
0.5	Sub-Repair(s) roof/cruise air filters cleaned		\$150.00	\$75.00
				1 of 3



ENCORE

BusForSale.com

Estimate

#61 05/02/2023

Quantity	Item	Rate	Amount
1	Sub-Repair(s) hot water heater	\$738.15	\$738.15
1	Sub-Repair(s) fan clutch	\$2,109.74	\$2,109.74
2.5	Sub-Repair(s) labor	\$150.00	\$375.00
1	Sub-Repair(s) bunk lights	\$12.97	\$12.97
0.25	Sub-Repair(s) labor	\$150.00	\$37.50
6	Sub-Repair(s) all belts	\$50.41	\$302.46
0.5	Sub-Repair(s) labor	\$150.00	\$75.00
1	Sub-Repair(s) rear main seal	\$1,928.50	\$1,928.50
10.75	Sub-Repair(s) labor	\$150.00	\$1,612.50
1	Sub-Repair(s) alt light on - #1 alt	\$1,321.04	\$1,321.04
2	Sub-Repair(s) labor	\$150.00	\$300.00
5	Sub-Repair(s) bay door actuators	\$106.94	\$534.70
1.75	Sub-Repair(s) labor	\$150.00	\$262.50
2	Sub-Repair(s) mirrors	\$1,860.01	\$3,720.02
1	Sub-Repair(s) docking lights	\$189.30	\$189.30
0.25	Sub-Repair(s) labor	\$150.00	\$37.50
1	Sub-Repair(s) vanner	\$1,203.00	\$1,203.00
0.75	Sub-Repair(s) labor	\$150.00	\$112.50
	SubTotal SubTotal		\$18,512.25
1	Sub-Repair(s) shop/epa fee		\$555.37





Estimate

BusForSale.com

05/02/2023

Quantity	Item	Rate	Amount
1	Sub-Repair(s) TO BE DETERMINED ITEMS: replace fresh water drain backup camera adjust rear lounge door keypad inop bay floor at genset exhaust balance light srestring shade hot water heater install toe kick heaters condo curtains ecm codes hvac motor brushes mirror install		\$0.00
		Subtotal	\$19,067.62
		Tax Total (%)	\$1,763.75
		Total	\$20,831.37

Key Considerations

This quote is an estimate based on routing provided. A final invoice may be issued for any additional expenses.

Any additional expenses will be billed to the credit card on file (from the contract) for any additional expenses not included in the quote, but remain unpaid after 30 days from the invoice date. In addition, any tolls that are received by Encore after tour completion will be charged to the credit on file. (Most times the municipalities are tardy in sending out toll charges.)

- Buses are not held until a signed contract and deposit are received.

Costs to Be Paid by Customer by Client Credit Card or "Float" while on Tour -Parking -Tolls

- -Permits
- -Bus supplies and/or stock -Daily hotels on tour

DOT ComplianceIn accordance with the Federal DOT regulations the driver of the vehicle may not exceed 10 hours of driving time or 15 hours of on-duty time without taking an 8 hour off-duty break. The driver may not exceed 60 hours of on-duty time in a 7 day period or 70 hours of on-duty time in an 8 day period. With the new ELD laws in effect, there is an increased demand for double-drivers. If a double driver is needed, we must be notified within 14 days prior to the trip or we cannot be held responsible, or we may not be able to accommodate the request.