

Busforsale.com ~ Bus Inspection

Today's Date

5-8-25

Bus Name

Dark Horse

Yr/Make/Model

2015 Prevost H3-45

VIN#

2PCVS3498FL712784

Mileage

461569

Door Code

33953

Tech & Time:

MP 2.0

Engine Type

Volvo D13 I500P

Transmission Type

Allison

Generator

Perkins

Gen Hours 16

Engine Serial #

0131075092

Transmission Serial#

6610399198

LN11039N785879K

DOT Compliance Items

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
Driving Fog Lights *	☒	☐					
Gauge Lights *	☒	☐					
Dash Lights *	☒	☐					
ABS Light *	☒	☐					
Headlights *	☒	☐					
Brake Lights *	☒	☐					
Clearance Lights *	☐	☒	rear side clearance lights out, 2 red				
Tail Lights *	☒	☐					
Turn Lights *	☒	☐					
Escape Hatch Operational *	☒	☐					
Windshield *	☒	☐					
Driver Glass *	☒	☐					
Windshield Wipers *	☒	☐					
Upper Control Arms *	☒	☐					
Lower Control Arms *	☒	☐					
Suspension - Front *	☒	☐	Needs Power Steering assist, ball joints bad				
Suspension - Rear *	☒	☐					
Power Steering *	☐	☒	leaking at reservoir & pump				
Exhaust System/Muffler *	☐	☒	Exhaust leak at DOC				

Brakes

Front % *	☒	☐	70%				
Drive % *	☒	☐	80%				
Tag % *	☒	☐	70% rotors rusted up				
Jake Brake *	☐	☐					
Shock - Front *	☒	☐					
Shock - Rear *	☒	☐					

Tires

Front % *	☒	☐	15/32 DOT-2022				
Drive % *	☒	☐	12/32 DOT-				
Tag % *	☒	☐	16/32 DOT-2023				
Wheelseals - Front *	☒	☐					
Wheelseals - Rear *	☒	☐					

Seat Belts

Driver *	☒	☐					
Jump *	☒	☐					
Passenger (if applicable) *	☐	☐					

Other

Mud Flaps	☐	☒	P.S. Missing Front & rear				
Coolant line	☐	☒	Brewed coolant line wrong length - routed wrong				
	☐	☐					
	☐	☐					
	☐	☐					

Lock cylinder - Bay keys

* DOT Requirement

Busforsale.com ~ Bus Inspection

Bus Name: 0

Conversion / Bus Interior

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
Smoke/Co2 Detector	☐	☐					
Switch Lights	☐	☐					
Switch Identification	☒	☐					
Water Pump Operation	☐	☐					
Fresh Water Drain	☐	☐					
Sewer Drain	☐	☐					
Air Vents Dash	☐	☐					
Air Vents Coach	☐	☐					
Driver Stereo	☐	☐					
BackUp Camera	☐	☐					
Driver Seat Operation	☒	☐					
Driver Seat	☒	☐					
<i>very Fancy</i>	☐	☐					

Finishes

Tile Condition	☐	☐					
Laminate Condition	☐	☐					
Shower Operational	☐	☐					
Air Pocket Doors	☐	☐					
Pocket Doors	☐	☐					
Cabinet Hardware	☐	☐					
Ceiling Mirrors	☐	☐					
Shower Head	☐	☐					
Sink Head	☐	☐					
Upholstery-Front	☐	☐					
Upholstery-Rear	☐	☐					
Window Tint	☒	☐					
Windshield Rubber	☒	☐					

Fuel System

Fuel Level	☒	☐	<i>shows 3/4 Tank</i>				
Level Low System	☒	☐	<i>valid leveling system</i>				

Bumpers

Front Bumper	☒	☐	<i>Paint chipping off</i>				
Rear Bumper	☐	☒	<i>cracked on P.S. corner</i>				

Keys

Door Code/Keypad	☒	☐					
Door	☐	☐					
Ignition	☒	☐					
Engine	☐	☐					
Bays	☐	☐					
Cabinets/Interior	☐	☐					

Other

	☐	☐					
	☐	☐					
	☐	☐					
	☐	☐					
	☐	☐					
	☐	☐					

Electronics / Remotes

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
Stereo Operational-F	☐	☐					
Stereo Operational-R	☐	☐					
TV - Front	☐	☐					
TV - Rear	☐	☐					
Generator Remote Start	☒	☐					
Genset Batteries	☒	☐					
Inverter Remote	☐	☐					
In-Motion Satellite Locks	☐	☐					
Speakers Operational	☐	☐					
Satellite Syst. Operational	☐	☐					

Switches / Gauges / Lights

Ship to Shore Switch/Plug	☒	☐					
Interior Lights 12v	☐	☐					
Interior Lights 120v	☐	☐					
Light Switches	☐	☐					
Step Lights	☐	☐					
Buddy Light	☐	☐					
Driver Light	☐	☐					
Day/Night Shades	☐	☐					
Toilet	☐	☐					
Speedometer	☐	☐					
Fuel Gauge	☐	☐					
Temp Gauge	☐	☐					
Amp Gauge	☐	☐					
Volt Gauge	☐	☐					
DC Volt Gauge	☐	☐					

Operations

Roof Vent Fans	☐	☐					
Roof/Cruise Air Operational	☐	☐					
Roof/Cruise Air Filters	☐	☐					
Hot Water Heater	☐	☐					
Step Slide Operational	☐	☐					
Webasto	☐	☐					
Toe Kick Heaters	☐	☐					
Heat Pumps	☐	☐					
Fan Clutch	☒	☐					
City/Air Horn	☒	☐					
A/C Air Tank	☐	☐					
Alignment	☒	☐					

Bunks

Bunk Lights	☐	☐					
Condo Curtains	☐	☐					
Bunk Curtains	☐	☐					
Mattresses	☐	☐					
Bunk TV's	☐	☐					

Busforsale.com ~ Bus Inspection

Bus Name: 0

Engine & Mechanical							
	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
ECM Codes	☐	☒	regen codes, leak at DOC				
House Alternator Charge	☒	☐					
Drive AC Operational	☒	☐					
Coach AC Operational	☒	☐					
Coach AC Components	☐	☒	Bitzer Front seal leaking				
HVAC Motor Brushes	☒	☐					
House Batteries	☒	☐					
Chassis Batteries	☒	☐					
Radiator Condition	☒	☐	newer rad / leaking at Purge/line				
Belt Condition	☒	☐					
Charge Air Cooler	☒	☐					
Airbags	☐	☒	Tag air bags dry rotten				
Transmission Seal	☒	☐					
Rear Main Seal	☒	☐					
Pinion Seal	☒	☐					
Mitre Box Seals	☐	☐	No Miter box has drive line to Fan clutch				
50DN Seals	☐	☐	NO 50DN - Bosch alts				
Charging	☒	☐					
Mitre Box Dipstick	☐	☐					
Oil Dipstick	☒	☐					
Trans Dipstick	☐	☒	Been cut and spliced / leaking at trans				
Differential Oil	☒	☐	Needs diff Breather				
Coolant Level	☐	☒	Low due to leaks reservoir & pump				
Transmission Fluid Level	☒	☐					
Motor Oil Level	☒	☐					
Power Steering Level	☐	☒	Low due to leak				
Coolant leak	☐	☒	Coolant leak near thermostat housing, Coolant Filter bypass leaking at Pipe.				
Oil leaks	☐	☒	Rocker box, valve cover, Oil Filter housing/cooler leaking at Solenoid				

Exterior

Body Damage	☐	☐	See last Page				
Bay Door Shocks	☐	☒	Engine door won't stay up				
Bay Door Actuators	☐	☒	P.S. 5 th bay won't unlock, no key				
Bay Door Operation	☒	☐					
Roof Inspection	☐	☐					
Roof Seals	☐	☐					
Mirror Chrome Condition	☒	☐					
Door Latches	☐	☐					
Trailer Wiring	☒	☐					
Rub Rails	☒	☐					
Side Glass	☒	☐					
Entrance Door Glass	☐	☒	Hazed at bottom				
Shore Cord	☒	☐					
Awning Operable	☐	☐					
Docking Lights	☒	☐					
Mirror Operation	☒	☐					
Paint Repair	☐	☐	See last Page				
Air leak	☐	☒	Air leak by AHi Module				

ANNUAL VEHICLE INSPECTION REPORT

VEHICLE HISTORY RECORD	
REPORT NUMBER	FLEET UNIT NUMBER
DATE	






MOTOR CARRIER OPERATOR	INSPECTOR'S NAME (PRINT OR TYPE)
ADDRESS	THIS INSPECTOR MEETS THE QUALIFICATION REQUIREMENTS IN SECTION 396.19. ☐ YES
CITY, STATE, ZIP CODE	VEHICLE IDENTIFICATION (☒ AND COMPLETE) ☐ LIC. PLATE NO. ☐ VIN ☐ OTHER
VEHICLE TYPE ☐ TRACTOR ☐ TRAILER ☐ TRUCK ☐ BUS ☐ (OTHER)	INSPECTION AGENCY/LOCATION (OPTIONAL)

VEHICLE COMPONENTS INSPECTED											
OK	NEEDS REPAIR	REPAIRED DATE	ITEM	OK	NEEDS REPAIR	REPAIRED DATE	ITEM	OK	NEEDS REPAIR	REPAIRED DATE	ITEM
☒			1. BRAKE SYSTEM	☒			6. SAFE LOADING	☒			10. TIRES
☒			a. Service Brakes	☒			a. Part(s) of vehicle or condition of loading such that the spare tire or any part of the load or dunnage can fall onto the roadway.	☒			a. Tires on any steering axle of a power unit.
☒			b. Parking Brake System	☒			b. Protection against shifting cargo.	☒			b. All other tires.
☒			c. Brake Drums or Rotors	☒			c. Container securement devices on intermodal equipment.	☒			11. WHEELS AND RIMS
☒			d. Brake Hose	☒				☒			a. Lock or Side Ring
☒			e. Brake Tubing	☒				☒			b. Wheels and Rims
☒			f. Low Pressure Warning Device	☒				☒			c. Fasteners
☒			g. Tractor Protection Valve	☒				☒			d. Welds
☒			h. Air Compressor	☒				☒			12. WINDSHIELD GLAZING
☒			i. Electric Brakes	☒				☒			Requirements and exceptions as stated pertaining to any crack, discoloration or vision reducing matter (reference 393.60 for exceptions).
☒			j. Hydraulic Brakes	☒				☒			13. WINDSHIELD WIPERS
☒			k. Vacuum Systems	☒				☒			Any power unit that has an inoperative wiper, or missing or damaged parts that render it ineffective.
☒			2. COUPLING DEVICES	☒			7. STEERING MECHANISM	☒			14. OTHER
☒			a. Fifth Wheels	☒			a. Steering Wheel Free Play	☒			List any other condition(s) which may prevent safe operation of this vehicle.
☒			b. Pintle Hooks	☒			b. Steering Column	☒			<i>Exhaust leak at Doc</i>
☒			c. Drawbar/Towbar Eye	☒			c. Front Axle Beam and All Steering Components Other Than Steering Column	☒			<i>2 red clearance inop</i>
☒			d. Drawbar/Towbar Tongue	☒			d. Steering Gear Box	☒			<i>Power Steering assist</i>
☒			e. Safety Devices	☒			e. Pitman Arm	☒			<i>Tag air bags cracked/rotten</i>
☒			f. Saddle-Mounts	☒			f. Power Steering	☒			
☒			3. EXHAUST SYSTEM	☒			g. Ball and Socket Joints	☒			
☒			a. Exhaust system leaking forward of or directly below the driver/sleeper compartment.	☒			h. Tie Rods and Drag Links	☒			
☒			b. Bus exhaust system leaking or discharging in violation of standard.	☒			i. Nuts	☒			
☒			c. Exhaust system likely to burn, char, or damage the electrical wiring, fuel supply, or any combustible part of the motor vehicle.	☒			j. Steering System	☒			
☒			4. FUEL SYSTEM	☒			8. SUSPENSION	☒			
☒			a. Visible leak.	☒			a. Any U-bolt(s), spring hanger(s), or other axle positioning part(s) cracked, broken, loose or missing resulting in shifting of an axle from its normal position.	☒			
☒			b. Fuel tank filler cap missing.	☒			b. Spring Assembly	☒			
☒			c. Fuel tank securely attached.	☒			c. Torque, Radius or Tracking Components	☒			
☒			5. LIGHTING DEVICES	☒			9. FRAME	☒			
☒			All lighting devices and reflectors required by Part 393 shall be operable.	☒			a. Frame Members	☒			
☒				☒			b. Tire and Wheel Clearance	☒			
☒				☒			c. Adjustable Axle Assemblies (Sliding Subframes)	☒			


INSTRUCTIONS: MARK COLUMN ENTRIES TO VERIFY INSPECTION. ☒ OK, ☒ X NEEDS REPAIR, ☒ NA IF ITEMS DO NOT APPLY. REPAIRED DATE

CERTIFICATION: THIS VEHICLE HAS PASSED ALL THE INSPECTION ITEMS FOR THE ANNUAL VEHICLE INSPECTION IN ACCORDANCE WITH 49 CFR PART 396.


Bus Name: 0

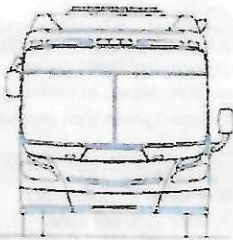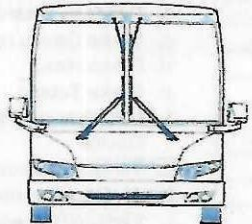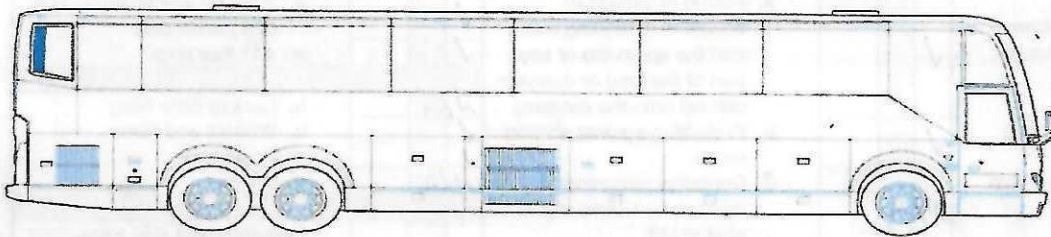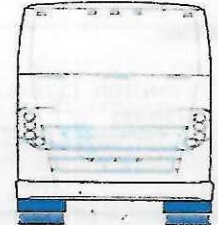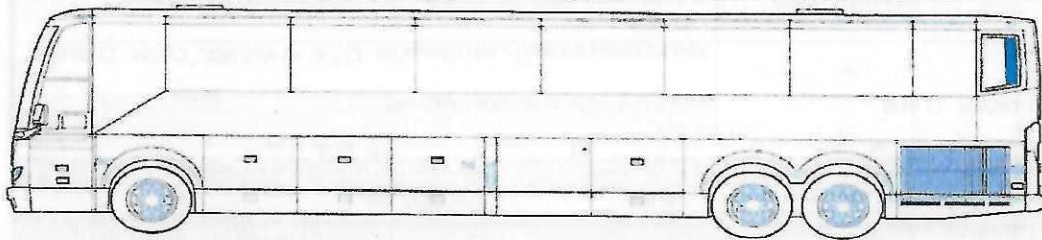


Front View

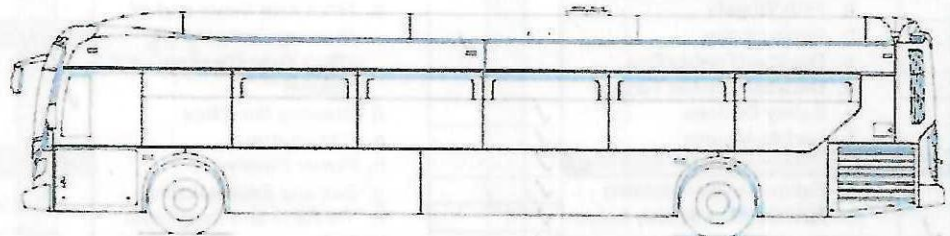

Street side View

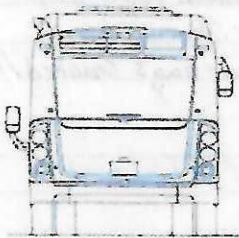

Rear View

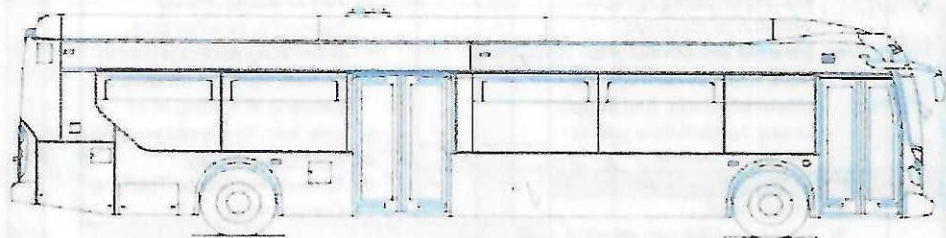

Curbside View