

Busforsale.com ~ Bus Inspection

Today's Date 5-27-25

Bus Name Resilience

Yr/Make/Model 1996 Prevost XL

VIN# 2PCE33497T1025865

Mileage 94325

Door Code _____ Tech & Time: _____

Engine Type Detroit Series 60 DEC III

Transmission Type Alison - B550RM

Generator 2203 Gen Hours 2774

Engine Serial # 06R028756951-0460

Transmission Serial# 9430007317

DOT Compliance Items

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
Driving Fog Lights *	☒	☐					
Gauge Lights *	☒	☐					
Dash Lights *	☒	☐					
ABS Light *	☒	☐					
Headlights *	☒	☐					
Brake Lights *	☒	☐					
Clearance Lights *	☐	☒	<u>1 Amber, 1 red in op</u>				
Tail Lights *	☐	☒	<u>2 Tail lights in op</u>				
Turn Lights *	☒	☐					
Escape Hatch Operational *	☐	☐					
Windshield *	☒	☐					
Driver Glass *	☐	☒	<u>Fish bowl</u>				
Windshield Wipers *	☐	☒					
Upper Control Arms *	☐	☐	<u>Solid axle Front end</u>				
Lower Control Arms *	☐	☐	<u>Boot busted on tie rod / Power Steering assist</u>				
Suspension - Front *	☐	☒	<u>radius rod bushings / dog bones</u>				
Suspension - Rear *	☐	☒	<u>radius rod bushings</u>				
Power Steering *	☒	☐	<u>dust cover not secure on Power Steering assist</u>				
Exhaust System/Muffler *	☒	☐					

Brakes

Front % *	☐	☒	<u>Hot spots on rotors Pads - 70%</u>				
Drive % *	☒	☐	<u>70%</u>				
Tag % *	☐	☒	<u>Hot spot on rotors Pads - 70%</u>				
Jake Brake *	☐	☐					
Shock - Front *	☐	☒	<u>leaking / bushings busted</u>				
Shock - Rear *	☐	☒	<u>bushings busted</u>				

Tires

Front % *	☒	☐	<u>14/32</u>				
Drive % *	☐	☒	<u>9/32</u>				
Tag % *	☒	☐	<u>16/32</u>				
Wheelseals - Front *	☒	☐					
Wheelseals - Rear *	☒	☐					

Seat Belts

Driver *	☒	☐					
Jump *	☒	☐					
Passenger (if applicable) *	☐	☐					

Other

	☐	☐					
	☐	☐					
	☐	☐					
	☐	☐					
	☐	☐					

Bus Name: 0

Conversion / Bus Interior

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
Smoke/Co2 Detector	☐	☐					
Switch Lights	☐	☐					
Switch Identification	☒	☐					
Water Pump Operation	☐	☐					
Fresh Water Drain	☐	☐					
Sewer Drain	☐	☒	PooP tank leaking in Floor				
Air Vents Dash	☐	☐					
Air Vents Coach	☐	☐					
Driver Stereo	☐	☐					
BackUp Camera	☐	☐					
Driver Seat Operation	☐	☒	NO air to Seat				
Driver Seat	☒	☐					

Finishes

Tile Condition	☐	☐					
Laminate Condition	☐	☐					
Shower Operational	☐	☐					
Air Pocket Doors	☐	☐					
Pocket Doors	☐	☐					
Cabinet Hardware	☐	☐					
Ceiling Mirrors	☐	☐					
Shower Head	☐	☐					
Sink Head	☐	☐					
Upholstery-Front	☐	☐					
Upholstery-Rear	☐	☐					
Window Tint	☒	☐					
Windshield Rubber	☒	☐					

Fuel System

Fuel Level	☒	☐	Half Tank				
Level Low System	☒	☐	Leans to P.S.				

Bumpers

Front Bumper	☒	☐					
Rear Bumper	☒	☐					

Keys

Door Code/Keypad	☐	☐					
Door	☐	☐					
Ignition	☐	☐					
Engine	☐	☐					
Bays	☐	☐					
Cabinets/Interior	☐	☐					

Other

	☐	☐					
	☐	☐					
	☐	☐					
	☐	☐					
	☐	☐					
	☐	☐					

Busforsale.com ~ Bus Inspection

Bus Name: 0

Electronics / Remotes

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
Stereo Operational-F	☐	☐					
Stereo Operational-R	☐	☐					
TV - Front	☐	☐					
TV - Rear	☐	☐					
Generator Remote Start	☐	☐					
Genset Batteries	☐	☒	dead Battery				
Inverter Remote	☐	☐					
In-Motion Satellite Locks	☐	☐					
Speakers Operational	☐	☐					
Satellite Syst. Operational	☐	☐					

Switches / Gauges / Lights

Ship to Shore Switch/Plug	☐	☐					
Interior Lights 12v	☐	☐					
Interior Lights 120v	☐	☐					
Light Switches	☐	☐					
Step Lights	☐	☐					
Buddy Light	☐	☐					
Driver Light	☐	☐					
Day/Night Shades	☐	☐					
Toilet	☐	☐					
Speedometer	☐	☐					
Fuel Gauge	☐	☐					
Temp Gauge	☐	☐					
Amp Gauge	☐	☐					
Volt Gauge	☐	☐					
DC Volt Gauge	☐	☐					

Operations

Roof Vent Fans	☐	☐					
Roof/CruiseAir Operational	☐	☐					
Roof/Cruise Air Filters	☐	☐					
Hot Water Heater	☐	☐					
Step Slide Operational	☐	☐					
Webasto	☐	☐					
Toe Kick Heaters	☐	☐					
Heat Pumps	☐	☐					
Fan Clutch	☒	☐	rubbing House alt wiring				
City/Air Horn	☒	☐					
A/C Air Tank	☐	☐					
Alignment	☒	☐					

Bunks

Bunk Lights	☐	☐					
Condo Curtains	☐	☐					
Bunk Curtains	☐	☐					
Mattresses	☐	☐					
Bunk TV's	☐	☐					

Engine & Mechanical

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Price:	Labor:
ECM Codes	☐	☐					
House Alternator Charge	☒	☐	<i>wiring cables need secured</i>				
Drive AC Operational	☐	☒					
Coach AC Operational	☐	☒					
Coach AC Components	☐	☒	<i>Evap/condensor Fans Hitting Floor Possibly</i>				
HVAC Motor Brushes	☐	☒					
House Batteries	☐	☒	<i>alt wiring rubbing Fan blade.</i>				
Chassis Batteries	☒	☐					
Radiator Condition	☒	☐					
Belt Condition	☐	☒	<i>Needs all belts</i>				
Charge Air Cooler	☒	☐					
Airbags	☐	☒	<i>rear drive air bags / Tag Air bags</i>				
Transmission Seal	☐	☒	<i>out put Seal leaking / wiring harness Not Secure</i>				
Rear Main Seal	☐	☒	<i>leaking inside bell housing</i>				
Pinion Seal	☒	☐	<i>dust cover on driveline lose</i>				
Mitre Box Seals	☒	☐					
50DN Seals	☐	☒					
Charging	☒	☐					
Mitre Box Dipstick	☒	☐					
Oil Dipstick	☒	☐					
Trans Dipstick	☒	☐					
Differential Oil	☒	☐					
Coolant Level	☒	☐					
Transmission Fluid Level	☒	☐					
Motor Oil Level	☒	☐					
Power Steering Level	☒	☐					
<i>Oil leaks</i>	☐	☒	<i>Rear cam Cap, Thrust Plate, valve cover, rockerbox, oil line for turbo</i>				
<i>Fuel leaks</i>	☐	☒	<i>Fuel leak at filter housing</i>				

Exterior

Body Damage	☒	☒	<i>Yes, See last Page</i>				
Bay Door Shocks	☒	☐					
Bay Door Actuators	☐	☒	<i>3 in op on P.S. / 4 in op on D.S.</i>				
Bay Door Operation	☒	☐					
Roof Inspection	☒	☐	<i>roof air cover busted / Broken up</i>				
Roof Seals	☒	☐					
Mirror Chrome Condition	☒	☐	<i>Painted black</i>				
Door Latches	☐	☐					
Trailer Wiring	☐	☒	<i>Plug broken in half</i>				
Rub Rails	☐	☒	<i>Pretty much all of them damaged</i>				
Side Glass	☒	☐	<i>D.S. Rear Glass Turning Yellow</i>				
Entrance Door Glass	☐	☒	<i>Hazed, Fishbowl</i>				
Shore Cord	☒	☐					
Awning Operable	☒	☐					
Docking Lights	☒	☐					
Mirror Operation	☒	☐					
Paint Repair	☒	☐	<i>Yes, See last Page</i>				
<i>Tag lift + Chambers</i>	☐	☒	<i>D.S. Tag lift chamber broken, no air line</i>				

ANNUAL VEHICLE INSPECTION REPORT

VEHICLE HISTORY RECORD	
REPORT NUMBER	FLEET UNIT NUMBER
DATE	

MOTOR CARRIER OPERATOR	INSPECTOR'S NAME (PRINT OR TYPE)
ADDRESS	THIS INSPECTOR MEETS THE QUALIFICATION REQUIREMENTS IN SECTION 396.19. ☐ YES
CITY, STATE, ZIP CODE	VEHICLE IDENTIFICATION (☒ AND COMPLETE) ☐ LIC. PLATE NO. ☐ VIN ☐ OTHER
VEHICLE TYPE ☐ TRACTOR ☐ TRAILER ☐ TRUCK ☐ BUS ☐ (OTHER)	INSPECTION AGENCY/LOCATION (OPTIONAL)



VEHICLE COMPONENTS INSPECTED											
OK	NEEDS REPAIR	REPAIRED DATE	ITEM	OK	NEEDS REPAIR	REPAIRED DATE	ITEM	OK	NEEDS REPAIR	REPAIRED DATE	ITEM
☒			1. BRAKE SYSTEM	☒			6. SAFE LOADING	☒			10. TIRES
☒			a. Service Brakes				a. Part(s) of vehicle or condition of loading such that the spare tire or any part of the load or dunnage can fall onto the roadway.				a. Tires on any steering axle of a power unit.
☒			b. Parking Brake System	☒			b. Protection against shifting cargo.				b. All other tires.
		☒	c. Brake Drums or Rotors				c. Container securement devices on intermodal equipment.	☒			11. WHEELS AND RIMS
☒			d. Brake Hose	☒				☒			a. Lock or Side Ring
☒			e. Brake Tubing	☒				☒			b. Wheels and Rims
☒			f. Low Pressure Warning Device	☒				☒			c. Fasteners
☒			g. Tractor Protection Valve	☒				☒			d. Welds
☒			h. Air Compressor	☒							12. WINDSHIELD GLAZING
☒			i. Electric Brakes	☒							Requirements and exceptions as stated pertaining to any crack, discoloration or vision reducing matter (reference 393.60 for exceptions).
☒			j. Hydraulic Brakes	☒							13. WINDSHIELD WIPERS
☒			k. Vacuum Systems	☒							Any power unit that has an inoperative wiper, or missing or damaged parts that render it ineffective.
☒			2. COUPLING DEVICES	☒			7. STEERING MECHANISM	☒			14. OTHER
☒			a. Fifth Wheels	☒			a. Steering Wheel Free Play				List any other condition(s) which may prevent safe operation of this vehicle.
☒			b. Pintle Hooks				b. Steering Column				
☒			c. Drawbar/Towbar Eye				c. Front Axle Beam and All Steering Components Other Than Steering Column				
☒			d. Drawbar/Towbar Tongue	☒			d. Steering Gear Box				
☒			e. Safety Devices	☒			e. Pitman Arm				
☒			f. Saddle-Mounts	☒			f. Power Steering				
☒			3. EXHAUST SYSTEM	☒			g. Ball and Socket Joints				
☒			a. Exhaust system leaking forward of or directly below the driver/sleeper compartment.	☒			h. Tie Rods and Drag Links				
☒			b. Bus exhaust system leaking or discharging in violation of standard.	☒			i. Nuts				
☒			c. Exhaust system likely to burn, char, or damage the electrical wiring, fuel supply, or any combustible part of the motor vehicle.	☒			j. Steering System				
☒			4. FUEL SYSTEM	☒			8. SUSPENSION				
☒			a. Visible leak.	☒			a. Any U-bolt(s), spring hanger(s), or other axle positioning part(s) cracked, broken, loose or missing resulting in shifting of an axle from its normal position.				
☒			b. Fuel tank filler cap missing.	☒			b. Spring Assembly				
☒			c. Fuel tank securely attached.	☒			c. Torque, Radius or Tracking Components				
☒			5. LIGHTING DEVICES	☒			9. FRAME				
☒			All lighting devices and reflectors required by Part 393 shall be operable.	☒			a. Frame Members				
☒				☒			b. Tire and Wheel Clearance				
☒				☒			c. Adjustable Axle Assemblies (Sliding Subframes)				

INSTRUCTIONS: MARK COLUMN ENTRIES TO VERIFY INSPECTION. ☒ OK, ☒ X NEEDS REPAIR, ☒ NA IF ITEMS DO NOT APPLY. REPAIRED DATE


CERTIFICATION: THIS VEHICLE HAS PASSED ALL THE INSPECTION ITEMS FOR THE ANNUAL VEHICLE INSPECTION IN ACCORDANCE WITH 49 CFR PART 396.

Bus Name:


0

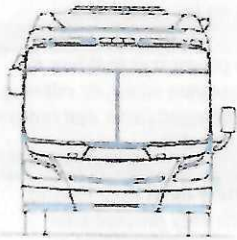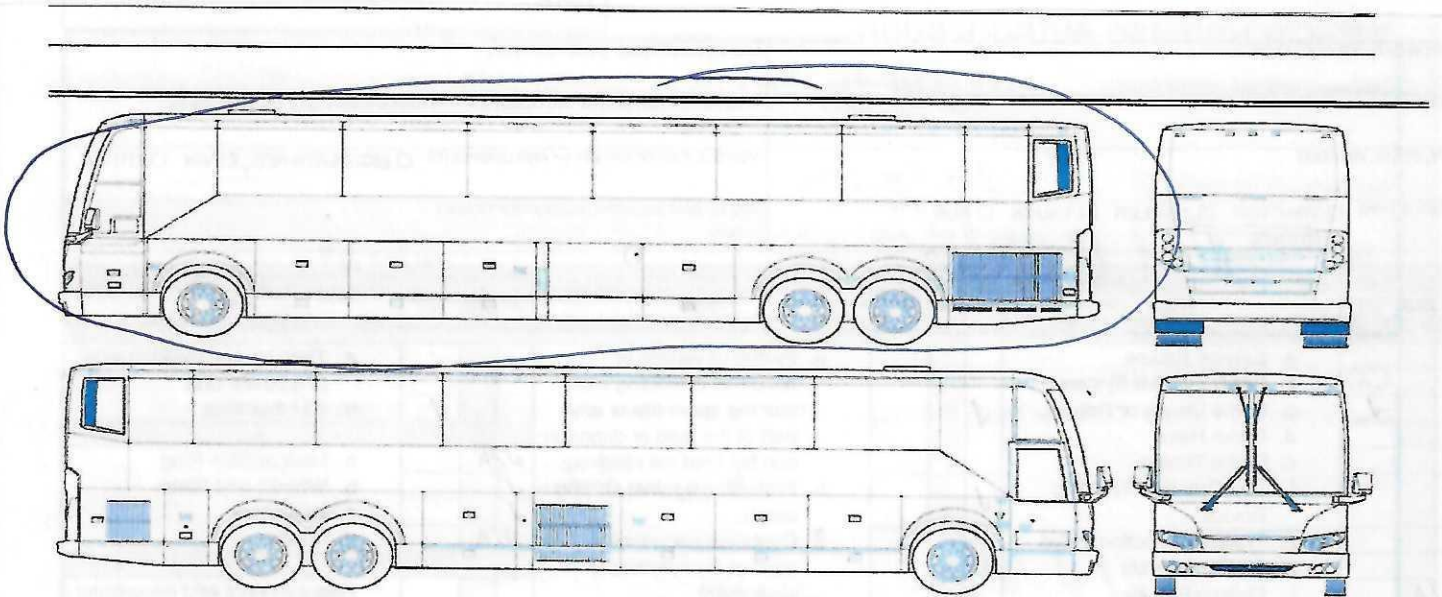


Front View

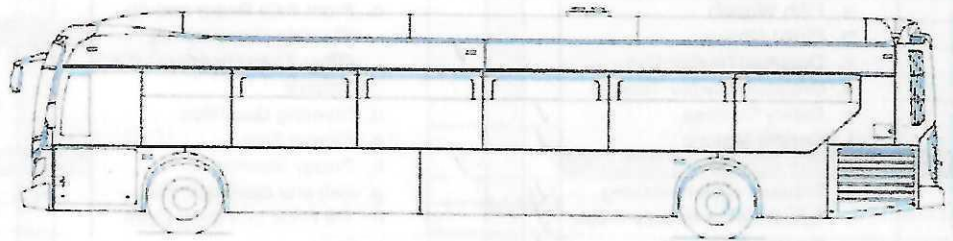

Streetside View

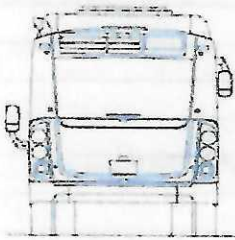

Rear View

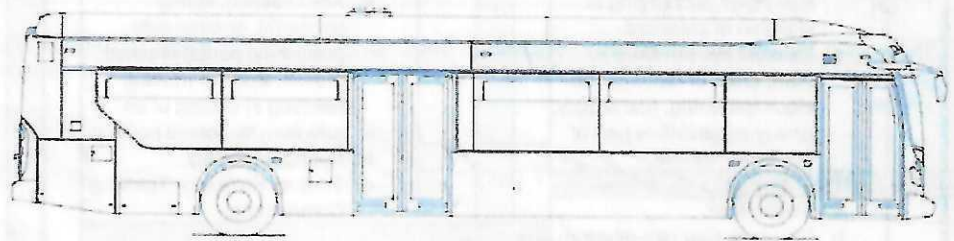

Curbside View