

Busforsale.com ~ Bus Inspection

Today's Date	8/5/2026		
Frenchy	2000 Prevost XLII	Bus Name	2PCW33496Y1027070
	97023 ECM 97371	39351	Tech & Time:
	Detroit Diesel	Allison B500	Generator
Yr/Make/ModelVIN#			
MileageDoor Code			
Engine TypeTransmission Type			
Engine Serial #	06R0540617	Transmission Serial#	6610044724
DOT Compliance Items			

Busforsale.com ~ Bus Inspection

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Pri
Driving Fog Lights *	☒	☐				
Gauge Lights *	☒	☐				
Dash Lights *	☒	☐				
ABS Light *	☒	☐				
Headlights *	☒	☐				
Brake Lights *	☒	☐				
Clearance Lights *	☐	☒	4 Upper Red/ upper amber	1	1@27.99/4@40.99	
Tail Lights *	☒	☐				
Turn Lights *	☒	☐				
Escape Hatch Operational *	☐	☐				
Windshield *	☐	☒	D/S Rock chip	1	\$450.99	
Driver Glass *	☒	☐				
Windshield Wipers *	☐	☒	need replaced	2	\$1,986.00	
Upper Control Arms *	☒	☐	new			
Lower Control Arms *	☒	☐	new			
Suspension - Front *	☒	☐				
Suspension - Rear *	☒	☐				
Power Steering *	☒	☐				
Exhaust System/Muffler *	☒	☐	new			
Brakes						
Front % *	☒	☐	75% remaining			
Drive % *	☒	☐	75% remaining			
Tag % *	☒	☐	75% remaining			
Retarder *	☒	☐				
Shock - Front *	☐	☒	need replaced	2	2@70.99/2@15.66	
Shock - Rear *	☐	☒	need replaced	6	\$74.99	
Tires						
Front % *	☒	☐	17/32 17/32 DOT 2022			
Drive % *	☒	☐	14/32 14/32 14/32 14/32 DOT 2019			
Tag % *	☒	☐	16/32 15/32 DOT 2019			
Wheelseals - Front *	☒	☐				
Wheelseals - Rear *	☒	☐				
Seat Belts						
Driver *	☒	☐				
Jump *	☒	☐				
Passenger (if applicable) *	☒	☐	n/a			
Other						
Dog Bone Bushing	☐	☒	steer axle	8	\$5.52	
	☐	☒	drive axle	8	\$5.52	
	☐	☐				
	☐	☐				
	☐	☐				

Busforsale.com ~ Bus Inspection

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Pri
Smoke/Co2 Detector	☐	☐	none			
Switch Lights	☒	☐				
Switch Identification	☒	☐				
Water Pump Operation	☒	☐				
Fresh Water Drain	☒	☐				
Sewer Drain	☒	☐				
Air Vents Dash	☒	☐				
Air Vents Coach	☒	☐				
Driver Stereo	☒	☐				
BackUp Camera	☐	☐	no monitor			
Driver Seat Operation	☒	☐				
Driver Seat	☒	☐				
	☐	☐				

Finishes

Tile Condition	☒	☐				
Laminate Condition	☐	☒	major chips and missing pieces			
Shower Operational	☒	☐				
Air Pocket Doors	☒	☐				
Pocket Doors	☒	☐				
Cabinet Hardware	☒	☐				
Ceiling Mirrors	☒	☐				
Shower Head	☒	☐				
Sink Head	☒	☐				
Upholstery-Front	☒	☐				
Upholstery-Rear	☒	☐				
Window Tint	☒	☐				
Windshield Rubber	☒	☐				

Fuel System

Fuel Level	☒	☐	1/4 tank			
Level Low System	☒	☐				

Bumpers

Front Bumper	☒	☐				
Rear Bumper	☒	☐				

Keys

Door Code/Keypad	☒	☐	39351			
Door	☒	☐				
Ignition	☒	☐				
Engine	☒	☐				
Bays	☒	☐				
Cabinets/Interior	☒	☐	n/a			

Other

Laminate repair	☐	☒	numerous laminate repairs needed throughout coach			
	☐	☐				
	☐	☐				
	☐	☐				
	☐	☐				
	☐	☐				

Electronics / Remotes

Busforsale.com ~ Bus Inspection

Stereo Operational-F	☐	☐	n/a		
Stereo Operational-R	☐	☐	n/a		
TV - Front	☒	☐			
TV - Rear	☒	☐			
Generator Remote Start	☐	☒	inoperable-starts at gen only		
Genset Batteries	☒	☐			
Inverter Remote	☒	☐			
In-Motion Satellite Locks	☐	☐			
Speakers Operational	☐	☐			
Satellite Syst. Operational	☐	☐			
	☐	☐			

Switches / Gauges / Lights

Ship to Shore Switch/Plug	☒	☐			
Interior Lights 12v	☐	☒	needs eight	8	
Interior Lights 120v	☒	☐			
Light Switches	☒	☐			
Step Lights	☒	☐			
Buddy Light	☒	☐			
Driver Light	☒	☐			
Day/Night Shades	☒	☐			
Toilet	☒	☐			
Speedometer	☒	☐			
Fuel Gauge	☒	☐	1/4 tank		
Temp Gauge	☒	☐			
Amp Gauge	☒	☐			
Volt Gauge	☒	☐			
DC Volt Gauge	☒	☐			

Operations

Roof Vent Fans	☐	☐	did not test		
Roof/CruiseAir Operational	☒	☐			
Roof/Cruise Air Filters	☒	☐			
Hot Water Heater	☐	☐	did not test		
Step Slide Operational	☒	☐			
Webasto	☒	☐			
Toe Kick Heaters	☒	☐			
Heat Pumps	☒	☐			
Fan Clutch	☒	☐			
City/Air Horn	☒	☐			
A/C Air Tank	☒	☐			
Alignment	☒	☐			

Bunks

Bunk Lights	☐	☐	n/a		
Condo Curtains	☐	☐			
Bunk Curtains	☐	☐			
Mattresses	☐	☐			
Bunk TV's	☐	☐			
	☐	☐			

Busforsale.com ~ Bus Inspection
Engine & Mechanical

	OK	Repair	Technician's Notes:	Qty:	Per Piece:	Pri
ECM Codes	☒	☐	no codes			
House Alternator Charge	☒	☐				
Drive AC Operational	☒	☐				
Coach AC Operational	☒	☐				
Coach AC Components	☒	☐				
HVAC Motor Brushes	☒	☐				
House Batteries	☐	☒	need to replace 3 8D	3	\$465.61	
Chassis Batteries	☒	☐				
Radiator Condition	☒	☐				
Belt Condition	☒	☐				
Charge Air Cooler	☒	☐				
Airbags	☒	☐				
Transmission Seal	☒	☐				
Rear Main Seal	☒	☐				
Pinion Seal	☒	☐				
Mitre Box Seals	☒	☐				
50DN Seals	☒	☐				
Charging	☒	☐				
Mitre Box Dipstick	☒	☐				
Oil Dipstick	☒	☐				
Trans Dipstick	☒	☐				
Differential Oil	☒	☐				
Coolant Level	☒	☐				
Transmission Fluid Level	☒	☐				
Motor Oil Level	☒	☐				
Power Steering Level	☒	☐				
	☐	☐				
	☐	☐				

Exterior

Body Damage	☐	☐	see last page			
Bay Door Shocks	☒	☐				
Bay Door Actuators	☐	☐				
Bay Door Operation	☒	☐				
Roof Inspection	☒	☐				
Roof Seals	☒	☐				
Mirror Chrome Condition	☒	☐				
Door Latches	☒	☐				
Trailer Wiring	☒	☐				
Rub Rails	☒	☐				
Side Glass	☐	☒	Front lounge P/S #1	5	\$1,260.99	
Entrance Door Glass	☒	☐				
Shore Cord	☒	☐				
Awning Operable	☐	☐	did not test			
Docking Lights	☒	☐				
Mirror Operation	☐	☒	P/S all inoperable D/S ok		1@\$71.99/\$45.99/\$63.99/\$45.99	
Paint Repair	☐	☒	see last page - clear coat flaring			
	☐	☐				

Busforsale.com ~ Bus Inspection
ANNUAL VEHICLE INSPECTION REPORT

VEHICLE HISTORY RECORD	
REPORT NUMBER	FLEET UNIT NUMBER
FRENCHY	
DATE 08/05/2026	

MOTOR CARRIER OPERATOR	INSPECTOR'S NAME (PRINT OR TYPE)
ADDRESS	THIS INSPECTOR MEETS THE QUALIFICATION REQUIREMENTS IN SECTION 396.19. ☐ YES
CITY, STATE, ZIP CODE	VEHICLE IDENTIFICATION (☒ AND COMPLETE) ☐ LIC. PLATE NO. ☐ VIN ☐ OTHER
VEHICLE TYPE ☐ TRACTOR ☐ TRAILER ☐ TRUCK ☐ BUS ☐ (OTHER)	INSPECTION AGENCY/LOCATION (OPTIONAL)

VEHICLE COMPONENTS INSPECTED											
OK	NEEDS REPAIR	REPAIRED DATE	ITEM	OK	NEEDS REPAIR	REPAIRED DATE	ITEM	OK	NEEDS REPAIR	REPAIRED DATE	ITEM
☒			1. BRAKE SYSTEM	☒			6. SAFE LOADING	☒			10. TIRES
☒			a. Service Brakes	☒			a. Part(s) of vehicle or condition of loading such that the spare tire or any part of the load or dunnage can fall onto the roadway.	☒			a. Tires on any steering axle of a power unit.
☒			b. Parking Brake System				b. Protection against shifting cargo.	☒			b. All other tires.
☒			c. Brake Drums or Rotors				c. Container securement devices on intermodal equipment.				11. WHEELS AND RIMS
☒			d. Brake Hose								a. Lock or Side Ring
☒			e. Brake Tubing								b. Wheels and Rims
☒			f. Low Pressure Warning Device								c. Fasteners
☒			g. Tractor Protection Valve								d. Welds
☒			h. Air Compressor								12. WINDSHIELD GLAZING
☒			i. Electric Brakes								Requirements and exceptions as stated pertaining to any crack, discoloration or vision reducing matter (reference 393.60 for exceptions).
☒			j. Hydraulic Brakes								13. WINDSHIELD WIPERS
☒			k. Vacuum Systems								Any power unit that has an inoperative wiper, or missing or damaged parts that render it ineffective.
			2. COUPLING DEVICES				7. STEERING MECHANISM				14. OTHER
			a. Fifth Wheels				a. Steering Wheel Free Play				List any other condition(s) which may prevent safe operation of this vehicle.
			b. Pintle Hooks				b. Steering Column				Lights
			c. Drawbar/Towbar Eye				c. Front Axle Beam and All Steering Components Other Than Steering Column				D/S windshield
			d. Drawbar/Towbar Tongue				d. Steering Gear Box				P/S wipers
			e. Safety Devices				e. Pitman Arm				Dog bone bushings
			f. Saddle-Mounts				f. Power Steering				
			3. EXHAUST SYSTEM				g. Ball and Socket Joints				
			a. Exhaust system leaking forward of or directly below the driver/sleeper compartment.				h. Tie Rods and Drag Links				
			b. Bus exhaust system leaking or discharging in violation of standard.				i. Nuts				
			c. Exhaust system likely to burn, char, or damage the electrical wiring, fuel supply, or any combustible part of the motor vehicle.				j. Steering System				
			4. FUEL SYSTEM				8. SUSPENSION				
			a. Visible leak.				a. Any U-bolt(s), spring hanger(s), or other axle positioning part(s) cracked, broken, loose or missing resulting in shifting of an axle from its normal position.				
			b. Fuel tank filler cap missing.				b. Spring Assembly				
			c. Fuel tank securely attached.				c. Torque, Radius or Tracking Components				
			5. LIGHTING DEVICES				9. FRAME				
			All lighting devices and reflectors required by Part 393 shall be operable.				a. Frame Members				
							b. Tire and Wheel Clearance				
							c. Adjustable Axle Assemblies (Sliding Subframes)				



INSTRUCTIONS: MARK COLUMN ENTRIES TO VERIFY INSPECTION: ☒ OK, ☒ NEEDS REPAIR, ☒ NA IF ITEMS DO NOT APPLY, REPAIRED DATE

CERTIFICATION: THIS VEHICLE HAS PASSED ALL THE INSPECTION ITEMS FOR THE ANNUAL VEHICLE INSPECTION IN ACCORDANCE WITH 49 CFR PART 396.


***Busforsale.com* ~ Bus Inspection**

paint
bubbling


OK

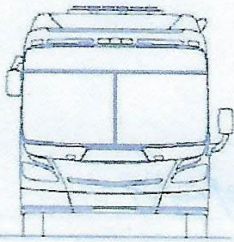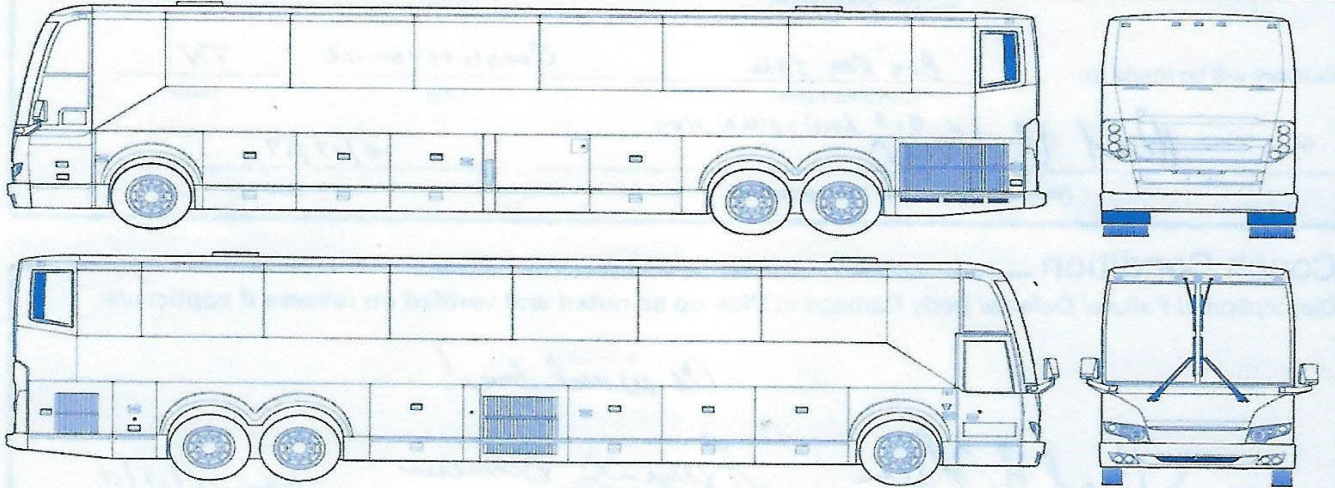


Front View

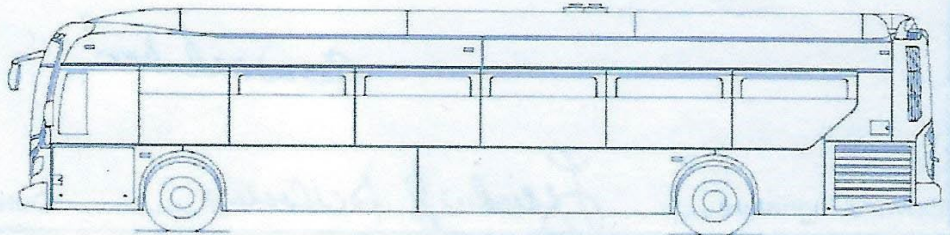

Streetside View

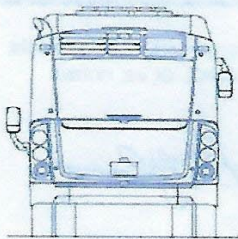

Rear View

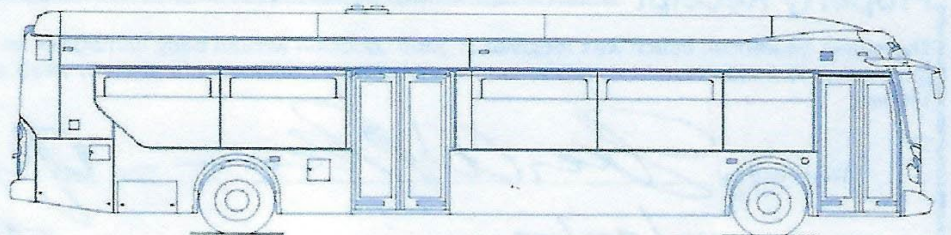

Curbside View

Paint cracking

OK

OK

OK

1,343

Frenchy

ice: Labor:

***Busforsale.com* ~ Bus Inspection**

[illegible]

ice: Labor:

tbd	

[illegible]

ice: Labor:

1

***Busforsale.com* ~ Bus Inspection**

[illegible]

***Busforsale.com* ~ Bus Inspection**

***Busforsale.com* ~ Bus Inspection**

Frenchy